USAARL Report No. 95-17







User Acceptability and Comfort of the Communications Earplug (CEP) When Used in the UH-1 Helicopter

By

Ben T. Mozo

Barbara A. Murphy

John E. Ribera

Aircrew Protection Division

19950509 112

February 1995

USET STALLEY INSTRUCTED 8

Approved for public release; distribution unlimited.

United States Army Aeromedical Research Laboratory Fort Rucker, Alabama 36362-0577

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Human use

Human subjects participated in these studies after giving their free and informed voluntary consent. Investigators adhered to AR 70-25 and USAMRDC Reg 70-25 on Use of Volunteers in Research.

Reviewed:

KEVIN T. MASON LTC, MC, MFS

Director, Aircrew Protection

Division

Released for publication:

Chairman, Scientific

Review Committee

DENNIS F. SHANAHAN

Colonel, MC, MFS

Commanding

SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATIO							Form Approved OMB No. 0704-0188	
1a. REPORT SEC Unclassifi		SIFICATI	ON		1b. RESTRICTIVE MARKINGS			
2a. SECURITY C		N AUTI	HORITY		3. DISTRIBUTION / AVAILABILITY OF REPORT			
2b. DECLASSIFIC	2b. DECLASSIFICATION / DOWNGRADING SCHEDULE				approved fo unlimited	or public re	lease,	distribution
4. PERFORMING USAARL Rep				R(S)	5. MONITORING	ORGANIZATION RE	PORT NU	MBER(S)
6a. NAME OF P U.S. Army Laboratory	Aeromedi			6b. OFFICE SYMBOL (If applicable) MCMR-UAD		ONITORING ORGAN Medical Rese		nd Materiel
6c. ADDRESS (C P.O. Box 6 Fort Rucke	520577				Fort Detric	y, State, and ZIPC ck MD 21702-5		
8a. NAME OF F ORGANIZAT		NSORIN	IG	8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT	INSTRUMENT IDE	NTIFICATI	ON NUMBER
8c. ADDRESS (Ci	ity, State, and	ZIP Cod	de)			UNDING NUMBERS		
					PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.	WORK UNIT ACCESSION NO.
					63787A	3016287A878	OF	321
UH-1 helic	otability copter	lassifica and	tion) comfort	of the communica	ation earplug	g (CEP) when	use i	n the
12. PERSONAL A Ben T. Moz		ra A.	Murphy.	and John E. Ril	pera			
13a. TYPE OF R			13b. TIME CO		14. DATE OF REPOR		Day) 15.	PAGE COUNT
16. SUPPLEMEN	TARY NOTAT	ION			1			
17.	COSATI		600.10	18. SUBJECT TERMS (C				
FIELD 20	GROUP 01	SUB	-GROUP	earplug, hearing capability, exp				ommunications
23	04							
19. ABSTRACT (Continue on reverse if necessary and identify by block number) Aviators and crewmembers assigned to the crash rescue (FLATIRON) unit at Fort Rucker, Alabama, participated in an evaluation of the communications earplug (CEP) in the aviation environment. They were asked to wear the two CEP configurations in combination with their personal SPH-4 helmet for three flights of at least 1 hour duration. One CEP configuration included a foam tip and the other included a premolded triple flange tip. Comments and responses provided by the volunteers showed the CEP, with some modifications, is acceptable for use in the aviation environment. Speech clarity of the CEP was judged to be an improvement over normal helmet/ear protection by 85 percent of the respondents. The CEP with foam tip was judged to be more comfortable than CEP with the triple flange tip. Comfort was judged to be between comfortable and mildly uncomfortable for the CEP with foam earplug tip. The volunteers rated the CEP as being helpful in achieving their mission. The results of this study show the CEP is comfortable and acceptable to the aviation crewmember.								
20. DISTRIBUTIO				OT DIE USERS	21. ABSTRACT SEC		TION	
22a. NAME OF F Chief, Sci	RESPONSIBLE	INDIVID	UAL	PT. DTIC USERS	Unclassifie 22b.TELEPHONE (W 334-255-690	nclude Area Code)		FICE SYMBOL -UAX-SI

Contents

Page
gures
List of tables
Introduction3
Background3
Methods5
Results and discussion
Earplug users
Speech quality
Helmet donning
Problem areas
Conclusions
Recommendations
References
Appendix A. User acceptability/comfort questionnaire for the communication earplug (CEP)
Appendix B. Results of user acceptability/comfort questionnaire for the communication earplug (CEP)

Accesio	on For			
NTIS	CRA&I	d		
DTIC	TAB			
Unann	ounced			
Justific	ation			
By				
DISTITU	unont			
A	vailability	Codes		
Dist	Avail a Spec			
	Spc.	Jiai		
H-1				
	N.			

List of figures

Figu	ıre	Page
1.	The CEP shown with foam and triple flange earplug tips	5
	<u>List of tables</u>	
1.	Sound attenuation values in dB and EEL in dBA of various helmet and earplug combinations measured using ANSI S12.6. EEL is calculated, using noise of the UH-1H at 100-knot cruise	4
2.	Number of flight hours flown by each volunteer while using each of the CEP earplug tips	7

Introduction

The objective of this study was to evaluate the communications earplug (CEP) in terms of user perception of capability, comfort, and acceptability when used in combination with the aviation helmet in the UH-1V flying environment. Volunteer flight crews from the crash rescue (FLATIRON) unit at Fort Rucker, Alabama, were used in the study.

The study was designed to evaluate the relative merits of CEP on the crewmember's comfort, and whether this mode of providing speech communication input to the individual through an earplug would be acceptable for use in aviation. The rationale for this device being acceptable to the aviation crewmember is that the CEP reduces the noise level at the ear and improves speech intelligibility (SI) while not increasing the discomfort. This study will show that the benefits of reduced noise and improved SI outweigh the potential discomfort of the aviator.

Background

Aviators use the SPH-4 series helmet to provide hearing protection and communications capability. Many aviators routinely use earplugs in combination with the helmet to provide an added margin of protection for some aircraft noise environments. However, use of combination protection can impair the aviator's ability to communicate since earphone output must overcome attenuation of the earplug to provide speech signals to the ear. Using the CEP reduces noise exposure and improves SI in high noise environments. Table 1 shows that when the CEP is worn in combination with the SPH-4 or HGU-56/P, the attenuation of noise is increased for all frequencies, which will result in improved speech-to-noise ratio. Noise exposure of individuals wearing the CEP compared with passive helmets worn alone and in combination with earplugs also are shown in Table 1. The effective exposure level (EEL) is the calculated A-weighted level at the ear of an individual wearing the hearing protector in a particular noise environment, i.e., a UH-1H at 100-knot cruise.

The CEP, shown in Figure 1, is a miniature dynamic earphone which may be used with either a urethane foam tip or a polyvinyl chloride triple flange tip. The CEP has a ¼-inch hollow plastic screw attached to the acoustic output port. The CEP/FOAM has a foam tip which is internally threaded to match the plastic screw on the CEP. A 2.5-mm hole through the center of the earplug provides a sound path from the CEP into the occluded portion of the ear canal. The CEP/TF is based on the triple flange earplug design which has been modified with a built-in pouch used to contain the CEP. Also, it has a hole from the CEP to the earplug tip providing a sound path to the ear. The CEP, with either earplug tip worn in combination with the SPH-4, yields significant improvements in speech signal-to-noise ratio, and provides additional sound attenuation that reduces noise exposure of aviators in the UH-1H noise environment.

Hearing protection afforded by the aviator's helmet can be compromised significantly when ancillary devices are worn in combination with it. For example: eyeglass frames break the earseal creating a leak, producing a sound path from outside to inside the earcup. Protective masks and cold weather hoods also provide leakage paths and decrease the hearing protection capability of the helmet. Loss of sound attenuation due to compatibility with other clothing or equipment is true for both passive and active noise reduction hearing protectors. The CEP is less susceptible to sound attenuation losses because none of the clothing or protective ensembles worn by the aviator break the seal within the ear canal.

Table 1.

Sound attenuation values in dB and EEL in dBA of various helmet and earplug combinations measured using ANSI S12.6. EEL is calculated, using noise of the UH-1H at 100-knot cruise.

				F	requen	cy in he	rtz				
		125	250	500	1000	2000	3150	4000	6300	8000	EEL
SPH4*	MEAN S.D.	17.7 3.2	15.9 2.5	23.3 2.7	28.8 3.2	33.7 3.9	40.0 3.3	42.9 3.4	46.5	44.1 3.8	79
SPH4*	MEAN	32.7	36.9	42.4	37.2	37.5	50.7	52.7	55.5	54.8	67
W/E-A-R	S.D.	7.2	7.2	7.9	7.6	4.1	5.9	6.1	5.2	4.5	
SPH4*	MEAN	30.6	33.3	36.2	32.0	38.6	49.0	52.2	53.6	53.7	69
W/TF	S.D.	6.6	5.9	6.8	4.0	4.3	4.0	3.8	4.5	3.6	
HGU-56**	MEAN S.D.	17.6 4.2	19.2 4.1	22.5 3.9	33.8 3.2	31.9 4.5	40.3 4.4	41.8 5.1	44.2 5.7	44.9 4.1	79
HGU-56**	MEAN	32.2	32.5	38.7	37.3	41.9	49.6	53.8	53.1	53.8	67
W/E-A-R	S.D.	3.8	6.6	6.2	5.5	3.8	3.4	4.0	3.6	3.5	
HGU-56**	MEAN	30.4	27.2	35.8	36.7	42.2	52.2	51.9	52.4	53.1	70
W/CEP	S.D.	6.4	3.2	7.9	6.7	4.6	4.6	6.2	4.8	4.9	
CEP/	MEAN	20.2	23.0	27.5	29.8	32.7	36.2	35.3	36.4	38.0	76
FOAM	S.D.	5.2	4.5	4.7	4.9	3.8	5.4	6.0	5.1	6.1	
CEP/	MEAN	23.4	23.2	23.3	20.0	26.9	28.0	24.5	32.2	33.5	83
TF	S.D.	8.7	8.2	8.9	6.0	6.5	6.2	5.9	10.6	8.9	

^{*} Reference USAARL Report No. 93-10

^{**} Reference Mozo and Murphy, 1995 (draft).

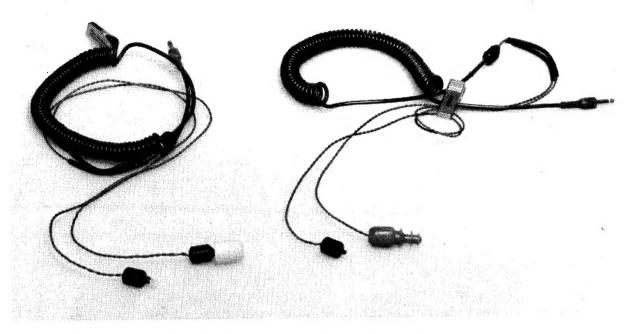


Figure 1. The CEP shown with foam and triple flange earplug tips.

Results of sound attenuation evaluations conducted at this laboratory, shown in Table 1, demonstrated the CEP provides adequate hearing protection for a typical noise found in Army helicopters. The EEL is a calculation that combines hearing protector attenuation less one standard deviation at each test frequency and A-weighted octave band noise levels in the helicopter to estimate the dBA level at the ear. Up to 8 hours exposure is allowed for noise levels less than 85 dBA in accordance with DoDI 6055.12, "Hearing conservation."

Methods

Aviators and crewmembers assigned to the FLATIRON unit at Fort Rucker were participants in this study. They were asked to wear the two CEP configurations, shown in Figure 1, in combination with their personal SPH-4 helmet for three flights of at least 1 hour duration. At the end of the last flight for that earplug tip condition, the volunteer was asked to complete the questionnaire shown in Appendix A.

Twenty human subjects were used in the comparison of the CEP/TF plus SPH-4 and CEP/FOAM plus SPH-4. The CEP devices were counterbalanced with half of the volunteers using CEP/TF first and the other half using the CEP/FOAM first. Otherwise, the volunteers performed their normal activities and wore ancillary equipment as they normally do. Hearing loss was not a controlled factor for this study.

A training session was provided to familiarize the volunteers with the CEP devices. Volunteers were given otoscopic exams by an audiologist or a certified occupational hearing conservation technician prior to beginning the study. The volunteers then were fitted with the CEP and instructed on proper insertion techniques. Volunteers were protected fully with their own helmet plus the CEP device. Noise exposure was below 85 dBA which is considered safe, in accordance with DODI 6055.12.

The CEP was integrated into the aircraft communications system with a special adapter which fits between the helmet and the aircraft communication connectors. The CEP connected into the adapter through a miniature phone jack. The adapter included circuitry to adjust the CEP sensitivity to approximate the sensitivity of the SPH-4 helmet at 1000 Hz. The CEP used in this evaluation was in a "Y" cord configuration with each ear's transducer at the end of two wires of approximately 18 inches in length. The other part of the "Y" cord was a coiled wire approximately 18 inches resting length and terminated with a miniature phone plug.

Results and discussion

Appendix B lists volunteer responses along with questions contained in the questionnaire for the convenience of the reader. Comments are shown verbatim and numerical rating responses are summarized. The yes/no type questions show the average value calculated using numerical assignments of yes=1 and no=0. The numerical rating responses of multiple interval questions use the value indicated by the respondents to calculate the average.

Measures of the perception of the volunteers relative to noise, speech and comfort were assessed to determine if the CEP was acceptable to the aviator/crewmember. It is important to keep in mind that perceptions should not replace the measurements conducted under controlled conditions in the laboratory. The perceptions are indicators of the subjective feelings and, therefore, the acceptability of a device to the respondent. Responses to questions about the two different earplug tips are separated into columns for easier comparisons by the reader.

Earplug users

Responses indicate that 70 percent of the volunteers normally wear earplugs during the performance of their flying duties while 40 percent wear glasses. The SPH-4 helmet was worn by 19 of the volunteers while 1 indicated he wore the SPH-3 helmet.

Volunteer flight time

Table 2 shows the length of time flown by each volunteer while wearing each CEP tip. The mean flight time for the 20 volunteers was 7.2 hours for each earplug tip which is above the 3-hour requirement in the protocol. In one case, the volunteer indicated he had flown only .8 hours while wearing the CEP/triple flange (TF) due to an ear canal irritation. The remaining volunteers indicated flight times of 3 hours or more.

Table 2.

Number of flight hours flown by each volunteer while using each of the CEP earplug tips.

while using each of the CEF carping tips.				
Vol	Foam	TF		
1	3.0	3.2		
2	8.0	.8		
3	4.5	8.0		
5	9.0	3.0		
6	9.0	5.5		
7	6.0	3.0		
8	4.5	18.1		
9	7.0	20.0		
10	5.0	6.5		
11	5.0	5.0		
13	10.0	4.0		
15	5.4	4.0		
16	6.0	4.0		
18	14.0	8.0		
20	6.0	5.0		
21	12.5	10.0		
22	3.0	3.0		
23	4.0	5.0		
24	10.0	10.0		
25	15.0	9.0		
	146.9	135.1		

Speech quality

Eighty percent of the volunteers said the CEP improved speech quality. The comments suggest the effect was to increase clarity and improve their ability to understand speech over the intercommunication system (ICS). Only one individual commented there was no difference. Several respondents said the volume level of the speech signal could be reduced while maintaining satisfactory SI. Comments from several volunteers indicated speech clarity was improved significantly and they were able to understand speech over the communications system better.

Noise reduction

Thirty-nine of the forty responses (one no-response) indicated noise levels at the ear were reduced. The scaled response average was very near "great reduction" for both tips. The hoist operators indicated the CEP was excellent for communications and hearing protection during hoist operations. Table 1 shows results of laboratory measurements which examined the sound attenuating qualities of the CEP with foam tip, TF tip when worn alone and worn in combination with the HGU-56/P helmet. The SPH-4 helmet also is shown in Table 1 to provide a reference for attenuation characteristics of devices commonly used in Army aviation. The sound attenuation of the HGU-56/P when worn in combination with the CEP far exceeds that of any hearing protector in the inventory.

Helmet donning

Helmet donning procedures were reported to be more difficult while wearing the CEP by 90 percent of the volunteers. As described earlier, the CEP requires a significant amount of wire management for the configuration used in this evaluation. As expected, the volunteers pointed out that additional time and planning was required to put on the helmet due to the length of the wires with the CEP. There were several comments relating to the CEP being pulled out of the ear during helmet donning. This shortcoming is corrected by routing the wire to the CEP from a point above the ear canal. This laboratory is currently developing a headband communication unit which includes the CEP and a state-of-the-art noise cancelling microphone. It is expected that this device will alleviate most of the donning problems encountered during this study.

Discomfort

Determining discomfort caused by the CEP device was the central objective of this study. Fifty percent of the foam users and 85 percent of the TF users reported some degree of discomfort. The respondents reported an average level of discomfort of 2.25 which is between no discomfort and mild discomfort for the foam tip while the TF tip average level was 1.65 which is

between mild and moderate discomfort. Seventy-five percent of the responses indicated discomfort was mild or less for the foam tip while 66 percent TF tip users indicated discomfort was mild or less. When asked the length of time when discomfort was first noticed, 18 volunteers wearing the CEP/foam indicated mild discomfort occurred within the first hour while only 10 using the CEP/TF indicated discomfort within that period. Some of the respondents indicated the foam tip plastic insert caused some discomfort. After review, we think this is due to improper insertion of the earplug. If the tip is forced into the canal, the foam will be forced back and away from the plastic insert. The proper insertion technique is to roll the foam into a smaller cylinder before insertion into the canal which will prevent exposing the plastic insert. Volunteer #2 reported that the CEP/TF caused a "blood blister" on his eardrum. Subsequent otoscopic examination by the audiometric technician revealed unidentified debris near the tympanic membrane that appeared dark red in color. This may have been dried blood from an irritation in the canal, or dark colored cerumen (ear wax). After consultation with the research audiologist, it has been determined that the likelihood of inserting the CEP, whether foam or triple flange, deep enough to cause damage to the eardrum itself is remote. These findings do not rule out the discomfort sensed by the aviator, nor the possibility that an irritation occurred on the canal walls due to repeated insertions and extractions of the CEP over time. The volunteer discontinued his evaluation of the CEP/TF, but continued the protocol with an additional 8 hours of flight time using the CEP/FOAM.

Problem areas

When asked to predict problems areas for the CEP within the operational environment, the majority of the respondents concluded that wire management was the primary problem. Increased donning time and inconvenience were classified as shortcomings of the CEP system used in this evaluation, due primarily to wire length.

Utility rating

Volunteers were asked to rate the utility for helping to achieve their mission. The average rating was 2.97 for foam tip and 3.15 for TF tip (3 is classified as helpful). Finally, they were asked if the CEP was acceptable for the operational environment. The response average was .85 for the foam tip and .80 for the TF tip. Comments indicated the CEP is not ready for fielding yet, but possesses potential to significantly improve communications and hearing protection.

Conclusions

Comments and responses provided by the volunteers indicate the CEP, with some modifications, is acceptable for use in the aviation environment. As expected, the long wires which must be managed by the user were identified as a problem area. The development of the communications headband will be directed at improving the areas of long wires and donning of the CEP and helmet.

Eighty-five percent of the respondents judged speech clarity of the CEP to be a significant improvement over their normal helmet/ear protection. Noise reduction at the ear was judged to be significantly improved by 95 percent of the volunteers. As a result of these improvements, most of the participants in this study expressed a desire to keep the test items after completion of the test.

The results show the CEP is acceptable to the aviation crewmembers used in this study. Laboratory evaluations show the CEP provides excellent sound attenuating properties, reducing the threat of noise induced hearing loss of the aviator and significant improvements in speech intelligibility. The CEP is a cost effective means to provide the aviator with increased hearing protection while improving their ability to understand speech through the communications system. The enhancement of speech communication should provide for better overall performance and cockpit coordination.

Recommendations

The positive responses from volunteers used in this study show the CEP is a viable technique to provide the aviator with improved hearing protection and communications capability. This laboratory recommends continued development of the CEP into a communications device for U.S. Army Aviation.

References

- Department of Defense. 1991. <u>Hearing conservation</u>. Washington, DC: Department of the Defense: DoDI 6055.12.
- Mozo, Ben T., Barlow, Linda S., and Murphy, Barbara A. 1993. Sound attenuation characteristics of the standard DH-132A and SPH-4 helmets worn in combination with standard issue earplugs. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL Report No. 93-10.
- Mozo, Ben T., and Murphy, Barbara A. 1995. Speech intelligibility characteristics of the active noise reduction hearing protectors, passive hearing protectors, and communications earplug hearing protector for use in aviation noise environments. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. Draft USAARL Report.

Appendix A.

User acceptability/comfort questionnaire for the communication earplug (CEP).

You have been asked to fly with a Communication Earplug (CEP) utilized with your flight helmet in order to evaluate its acceptance and comfort. We would be grateful if you would complete the following questionnaire:

Instructions:


Most questions are self explanatory, requiring a Yes/No response and leaving room for comment. Please try to be as precise as possible when making comments. Some questions will require you to make a mark on a continuum between extremes. Your response should be indicative of the strength of your feeling.

Thank you for your cooperation.

Gen	eral details:			
	ne			
Typ	e of helmet you normally use e of helmet used with CEP raft type roximate number of hours flown with the CEP	·		
1.	Do you normally wear earplugs in conjunction	on with the flight helmet?	Yes/No	
2.	Do you normally wear glasses when flying?	Yes/No		
	a. Did you wear glasses on this flight?	Yes/No		
3.	Compared to your normal helmet/ear protecti	on, did CEP effect speech	quality?	Yes/No
	a. How was speech quality effected?			
Com	ments:			

4.	Did the CEP reduce noise levels at the ear? Yes/No
↓ Great	reduction Slight reduction Hard to say No reduction
Com	ments:
5.	Did the addition of CEP result in differences in the helmet donning procedure? Yes/No
Comr	ments:
	a. Did you have any trouble with the wiring tangling with the helmet? Yes/No
Comr	ments:
6.	Did the CEP cause any discomfort in your ears? Yes/No
Comn	ments:
	a. When did you first notice the discomfort? Please circle the appropriate time below. ½-hr 1 hr 1½ hrs 2½ hrs 3 hrs 3½ hrs 4 hrs
7.	Were there any other adverse effects of CEP performance? Yes/No
Comn	nents:
8. (Yes/N	Can you foresee any problems within the operational environment for the CEP system?
Comn	nents:

9. Based on your flying experience, rate the utility of CEP for helping you achieve your mission.



Do you think the system is acceptable for the operational environment? Yes/No

Appendix B.

Results of user acceptability/comfort questionnaire for the communication earplug (CEP).

You have been asked to fly with a Communication Earplug (CEP) utilized with your flight helmet in order to evaluate its acceptance and comfort. We would be grateful if you would complete the following questionnaire:

Instructions:

Most questions are self explanatory, requiring a Yes/No response and leaving room for comment. Please try to be as precise as possible when making comments. Some questions will require you to make a mark on a continuum between extremes. Your response should be indicative of the strength of your feeling.

Type of helmet used with CEP. RESULTS: SPH-4 SPH-3 19 1 Aircraft type. RESULTS: UH-1V 20 20	Type	of helmet you normally use.	RESULTS:	SPH-4 19	SPH-3 1
Approximate number of hours flown with the CEP. RESULTS: FOAM TF TOTAL 146.9 135.1 MIN 3.0 .8 MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: Yes-8 No-12 Percent: 40	Type	of helmet used with CEP.	RESULTS:		
Approximate number of hours flown with the CEP. RESULTS: FOAM TF TOTAL 146.9 135.1 MIN 3.0 .8 MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: Yes-8 NO-12	Aircra	ift type.	RESULTS:		
RESULTS: FOAM TF TOTAL 146.9 135.1 MIN 3.0 .8 MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12				20	
TOTAL 146.9 135.1 MIN 3.0 .8 MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: Yes-8 NO-12	Appro	eximate number of hours flown with the CEI	Ρ.		
MIN 3.0 .8 MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: Yes-8 NO-12			RESULTS:	FOAM	TF
MAX 15.0 20.0 MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			TOTAL	146.9	135.1
MEAN 7.3 6.8 S.D. 3.5 4.8 1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			MIN	3.0	.8
1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			MAX	15.0	20.0
1. Do you normally wear earplugs in conjunction with the flight helmet? Yes/No RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			MEAN	7.3	6.8
RESULTS: Yes-14 No-6 Percent: 70 2. Do you normally wear glasses when flying? RESULTS: Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Ves/No RESULTS: YES-8 NO-12			S.D.	3.5	4.8
Percent: 70 2. Do you normally wear glasses when flying? Yes/No RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12	1.	Do you normally wear earplugs in conjunc		_	
2. Do you normally wear glasses when flying? RESULTS: Percent: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			RESULTS:	Yes-14	No-6
RESULTS: Yes-8 No-12 Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			Percent:	70	
Percent: 40 Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12	2.	Do you normally wear glasses when flying	g?	Yes/No	
Did you wear glasses on this flight? Yes/No RESULTS: YES-8 NO-12			RESULTS:	Yes-8	No-12
RESULTS: YES-8 NO-12			Percent:	40	
		Did you wear glasses on this flight?	Yes/No		
Percent: 40		-	RESULTS:	YES-8	NO-12
			Percent:	40	

3. Compared to your normal helmet/ear protection, did CEP effect speech quality? Yes/No

RESULTS: Yes-16 No-4 **Percent:** 80

How was speech quality effected?

Vol	CEP/FOAM	CEP/TF
1	Able to discern cockpit and radio calls better, better clarity	Quality was better
2	Clarity, lower volume setting	Clarity with a lower volume setting
3	The plugs increased clarity while also providing noise attenuation	Speech was louder and clearly understood. Extraneous aircraft noise was reduced
5	It made everybody's speech more clear and easier to understand	More clear and easier to understand
6	No response	Could understand better
7	None	No response
8	Improved	Significant improvement in clarity
9	No response	No response
10	Greatly improved	Much improved
· 11	No response	No response
13	Clear	Clear
15	A lot clearer with less outside noise, cleared out static	Helped it out
16	Improved drastically	Much better
18	Very clear	Very clear
20	Clearer	Better
21	I could hear other crew members a lot clearer	A lot clearer and less background noise
22	Clearer	Clearer and less aircraft noise, I like them although I did have minor wire problems

- Tremendously, I was able to relax more because aircraft noise was eliminated and actually communicated in a soft a voice tone than I do in normal conversation
- 24 No response
- I was able to hear all radios and crew conversations extremely well. I was able to turn my volume down and was finding myself speaking softer than before


As with the foam plugs, I was able to relax more because of reduced background noise; this enabled me to speak in a softer tone voice than I normally do when away from the aircraft

No response

I wasn't forcing my speech. Speech was calmer and softer. Didn't have to concentrate on enunciating each word

4. Did the CEP reduce noise levels at the ear? Yes/No

	FOAM	TF
RESULTS:	Yes-19	Yes-20
	No- 0	No- 0
	NR-1	NR- 0
Percent:	95	



*F=CEP/FOAM		FOAM	TF
T=CEP/TF	RESULTS:	3-14	3- 14
		2-2	2-5
		2.5-3	2.5-1
		1-1	1-0
		0-0	0-0
	Average:	2.73	2.7

Vol	CEP/FOAM	CEP/TF
1	Great reduction	Great reduction
2	Slight reduction	Slight reduction
3	Great reduction	Great reduction, this was the second phase of the study for me, using the triple flange rubber. Comfort level was significantly less for TF than the soft sponges
5	Great reduction, excellent for use with our hoist	Great reduction, excellent for use with our hoist
6	Great reduction	Slight reduction, did not hear as much outside noise
7	Great reduction, would like to keep this system, it really cut down on the overall noise level	Great reduction, I could actually hear the conversation over the ICS versus every other noise
8	Slight reduction, not as great as triple flange	Slight reduction in noise, normally wear TF anyway, but seemed to be an improvement in noise levels
9	Between slight reduction and great reduction	Great reduction

10	Great reduction	Great reduction
11	Great reduction	Great reduction
13	Great reduction	Great reduction
15	Great reduction	Great reduction
16	Great reduction	Great reduction
18	Great reduction	Slight reduction
20	Hard to say	Slight reduction
21	Great reduction, aircraft noise was reduced and speech and radio transmission was increased	Great reduction, background engine noise greatly reduced
22	Great reduction	Great reduction
23	Great reduction	Great reduction
24	Great reduction	Great reduction
25	Great reduction	Great reduction, aircraft and outside noise was greatly reduced

5. Did the addition of CEP result in differences in the helmet donning procedure? Yes/No

 RESULTS:
 FOAM Yes-18 Yes-18 No-2 No-2

 Percent:
 90

Vol	CEP/FOAM	CEP/TF
1	More time required to ensure wires did not tug when moving head from side to side	A little more prep time to ensure wires did not tug at earcup or become tangled with shoulder harness
2	Care has to be taken not to pull the CEP out	Care has to be taken not to pull the CEP out

3	No response	Had to pull helmet apart so as not to knock plug from ear
5	Took more time and wires were easily snagged	Took more time and things got tangled
6	Required more time due to wire sticking from under helmet	Slows the time
7	Only slightly because of all the wires	No response
8	Slows things down	Slowed down the process slightly, careful not to tangle wires or pull plugs out of ears when sliding earcup over ears
9	It took a little more time to don	The earplug, if not seated good, usually fell out
10	Very complicated, not appropriate for crash duty	Cumbersome wires
11	No response	No response
13	More difficult	More difficult
15	No response	No response
16	Have to open helmet more forcefully to fit helmet without loosening CEP fit	Definitely added to my helmet donning time
18	Took about 1 minute longer	Took about 30 seconds longer to put helmet on
20	Wires very cumbersome	Wires gotta go!!
21	I had to be careful of the CEP cords and plugs	Due to wires and plugs
22	Took extra time to put equipment on	Made a little longer prep time
23	A little cumbersome but well worth it	A little more time is required
24	No response	No response
25	No more than any other time with glasses	No response

Did you have any trouble with CEP wiring tangling with the helmet? Yes/No 5a.

FOAM

No-10 NR-1 **RESULTS:** Yes-9 45

Percent:

TF

No-8 NR-1 **RESULTS:** Yes-11

Percent: 55

Vol	CEP/FOAM	CEP/TF
1	No response	No response
2	No response	No response
3	I clip the CEP on the back of the seat and clip the wires above so they are ready to go	No response
5	Easily gets tangled with ALSE vest and helmet	No response
6	No response	No response
7	Wires need to be shortened going to the earplug	Sometimes the cord would tangle
8	No response	Too long, all three should be coiled
9	During hoist mission	During hoist operation your head is constantly moving from front to rear thus causing a tugging action in which the plug would come out of your ear
10	No response	No response
11	No response	No response
13	No response	No response
15	No response	No response
16	Minimal	No response
18	No response	No response
20	No response	No response
21	No response	No response
22	No response	No response
23	No response	A small amount of difficulty was found trying to move in and out of the aircraft but that was expected


24 No response


No response

I was aware of the possibility and was more careful

I was just more careful donning the helmet. The adapter was a bit cumbersome at first - falling down between my back and seat

6. Did the CEP cause any discomfort in your ears? Yes/No





	FOAM	TF
RESULTS:	3-10	3-3
	2.5-1	2.5-0
	2-4	2-9
	1-4	1-5
	.5-1	.5-2
	0-0	0-1
Average.	2 25	1.65

Vol	CEP/FOAM	CEP/TF		
1	Plastic insert in earplug caused some discomfort especially if wires were not slack under earcup	Discomfort when taking them out, more w/left ear, could feel indention caused by the ridges		
2	No response	Caused a blood blister on right eardrum		
3	No response	TF are uncomfortable and cause sores in my ear		
5	Very comfortable	Rubber ones are a little uncomfortable		

6	Foam is easier on ear canal than flange	Some pressure to ear canal
7	I was not used to having them in and they were uncomfortable	Only with the triple flange I noticed it was harder to keep them seated in place
8	Foam plugs are of insufficient thickness to protect ear canal from sharp points on transducers	None while wearing CEP, only on removal felt some soreness where contacted outer part of canal and rubbed as they were bent forward by friction between wire and earcup
9	Very little	Very little, noted with the flange
10	Some pain due to "softies" being too small	Pain when removing helmet
11	No response	No response
13	No response	No response
15	No response	No response
16	No response	Triple flange caused slight discomfort on a few occasions
18	No response	After about an hour started hurting my ear
20	No response	No response
21	After long periods of flight, the CEP begins to cause discomfort in the ear and around it	After long periods of time the hard flange creates greater discomfort than the soft plugs
22	No response	Not used to wearing them
23	No response	The triple flange plugs cause moderate discomfort after approximately thirty minutes of flight time
24	No response	No response
25	No response	The triple flange was painful in the ear canal after about one hour of wear

6a. When did you first notice the discomfort? Please circle the appropriate time below.

.5 hr 1 hr 1.5 hrs 2 hrs 2.5 hrs 3 hrs 3.5 hrs 4 hrs

RESULTS:

	.5	1.0	1.5	2.0	2.5	3.0	3.5	4.0	No response
FOAM	7	1	0	1	0	0	0	0	11
TF	4	6	6	2	1	0	0	1	4

7. Were there any other adverse effects of CEP performance? Yes/No

 FOAM
 TF

 RESULTS:
 YES-3
 YES-4

 NO-17
 NO-16

 Percent:
 15
 20

Vol	CEP/FOAM	CEP/TF
1	No response	No response
2	No response	No response
. 3	No response	No response
5	Speech was more clear and easily heard	No response
6	No response	No response
7	No response	No response
8	No response	Impedance did not match non-CEP pilot ICS system, battle for radio volume harmony distracted from mission
9	No response	No response
10	No response	No response
11	No response	No response

13	No response	No response
15	No response	No response
16	No response	No response
18	No response	The adapter cut out a lot (intermittent signal)
20	No response	No response
21	No response	No response
22	No response	No response
23	Explained earlier	No response
24	No response	No response
25	I was less tense. Being able to hear all commo clearly made flying less stressful. I was not at all fatigued after flying long hours with the CEP. I was very fatigued after flights without CEP.	I was physically relaxed using the CEP. I wasn't tense and emotionally frustrated because I could hear all the radios and conversations.


8. Can you foresee any problems within the operational environment for the CEP system? Yes/No

	FOAM	TF
RESULTS:	Yes-10	Yes-5
	No-10	No-15
Percent:	50	25

Vol	CEP/FOAM	CEP/TF
1	No response	No response
2	The amount of external wires can cause the wires to pull out	Amount of external wires can cause the wires to pull out
3	Possibly technique	Increased donning time. Only affects MEDEVAC since we are rushing
5	Needs to be built into the helmet itself	No response
6	Need to modify wiring of CEP	No response

8Wires tanglingNo response9No responseNo response10Need to be easier to don, especially for MEDEVACNo response11No responseNo response13No responseNo response15No responsePain in ears16Great piece of equipmentNo response18Takes longer to put in when in a fast mode like to an accidentAs long as the adapter keeps working20No responseNo response21It needs to be easier to fit and wear the CEPTangling with wires and ear discomfort on long missions22Wires or connections were broken twiceNo response23No responseNo response24No responseNo response25Only minor maintenance of the thin wire and possible breakage of the wire harnessNo response	7	No response	No response
Need to be easier to don, especially for MEDEVAC No response No response No response No response No response No response Pain in ears Great piece of equipment No response Takes longer to put in when in a fast mode like to an accident No response	8	Wires tangling	No response
No response No response No response No response No response Pain in ears Ro response Takes longer to put in when in a fast mode like to an accident No response No response No response It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions Wires or connections were broken twice No response Only minor maintenance of the thin wire and	9	No response	No response
No response No response Pain in ears No response Takes longer to put in when in a fast mode like to an accident No response No response No response No response It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions Wires or connections were broken twice No response	10	Need to be easier to don, especially for MEDEVAC	No response
No response Pain in ears No response Pain in ears Takes longer to put in when in a fast mode like to an accident No response No response No response It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions Wires or connections were broken twice No response No response No response No response No response Only minor maintenance of the thin wire and No response	11	No response	No response
16 Great piece of equipment No response 18 Takes longer to put in when in a fast mode like to an accident 20 No response No response 21 It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions 22 Wires or connections were broken twice No response 23 No response No response 24 No response 25 Only minor maintenance of the thin wire and No response	13	No response	No response
Takes longer to put in when in a fast mode like to an accident No response No response It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions Wires or connections were broken twice No response No response No response Only minor maintenance of the thin wire and No response	15	No response	Pain in ears
accident No response No response It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions Wires or connections were broken twice No response No response No response Only minor maintenance of the thin wire and No response	16	Great piece of equipment	No response
21 It needs to be easier to fit and wear the CEP Tangling with wires and ear discomfort on long missions 22 Wires or connections were broken twice No response 23 No response No response 24 No response No response 25 Only minor maintenance of the thin wire and No response	18	•	As long as the adapter keeps working
missions Wires or connections were broken twice No response No response No response No response Only minor maintenance of the thin wire and No response	20	No response	No response
No response No response No response Only minor maintenance of the thin wire and No response	21	It needs to be easier to fit and wear the CEP	
No response No response Only minor maintenance of the thin wire and No response	22	Wires or connections were broken twice	No response
25 Only minor maintenance of the thin wire and No response	23	No response	No response
	24	No response	No response
	25		No response

9. Based on your flying experience, rate the utility of CEP for helping you achieve your mission.



	FOAM	TF
RESULTS:	4-3	4-3
	3.5-3	3.5-2
	3-12	3-14
	2-0	2-1
	1-1	1-0
	0-1	0-0
Average:	2.97	3.15

Do you think the system is acceptable for the operational environment? Yes/No

 RESULTS:
 FOAM Yes-17
 TF Yes-16 No-3 No-4

 Percent:
 85
 80

Vol	CEP/FOAM	CEP/TF
1	No response	No response
2	Great system when using foam plugs, system became inoperable after about 8 hrs	If the system can be incorporated into the helmet it would be better
3	No response	Takes some work in getting used to. Does improve communication
5	Being on the crew in the back, you move around more. Again easily gets tangled and excellent for use with our hoist	No response
6	With slight modification	Will work well with some modifications

7	I think this system helps me get information better than just using the regular earplugs and the information comes through clearly	No response
8	Foam plugs and wiring needs to be redesigned	Not just yet, great idea, terrific potential, needs some bugs worked out. Thank you for helping us
9	No response	On numerous hoist training mission, it greatly improved the communication between pilot and hoist operator, the only problem is noted in #5
10	With appropriate modification	No response
11	No response	No response
13	No response	No response
15	No response	No response
16	No response	With some modifications to facilitate ease in donning, they are phenomenal
18	No response	Cut down on a/c noise, clearer voices and radio calls
20	Not as configured (wires)	Not with the wires
21	No response	Less wires would make it easier
22	No response	As long as the wire set holds up
23	No response	No response
24	Will be very useful if wiring system is changed	Useful if wiring system is changed
25	It could be fielded now for pilots experiencing hearing difficulty. Packaging a smaller (less wires) system in the near future will be seen better	Completely

Initial distribution

Commander, U.S. Army Natick Research,
Development and Engineering Center
ATTN: SATNC-MIL (Documents
Librarian)
Natick, MA 01760-5040

Chairman
National Transportation Safety Board
800 Independence Avenue, S.W.
Washington, DC 20594

Commander
10th Medical Laboratory
ATTN: Audiologist
APO New York 09180

Naval Air Development Center Technical Information Division Technical Support Detachment Warminster, PA 18974

Commanding Officer, Naval Medical Research and Development Command National Naval Medical Center Bethesda, MD 20814-5044

Deputy Director, Defense Research and Engineering ATTN: Military Assistant for Medical and Life Sciences Washington, DC 20301-3080

Commander, U.S. Army Research Institute of Environmental Medicine Natick, MA 01760

Library Naval Submarine Medical Research Lab Box 900, Naval Sub Base Groton, CT 06349-5900 Executive Director, U.S. Army Human Research and Engineering Directorate ATTN: Technical Library Aberdeen Proving Ground, MD 21005

Commander
Man-Machine Integration System
Code 602
Naval Air Development Center
Warminster, PA 18974

Commander Naval Air Development Center ATTN: Code 602-B Warminster, PA 18974

Commanding Officer Armstrong Laboratory Wright-Patterson Air Force Base, OH 45433-6573

Director Army Audiology and Speech Center Walter Reed Army Medical Center Washington, DC 20307-5001

Commander/Director
U.S. Army Combat Surveillance
and Target Acquisition Lab
ATTN: SFAE-IEW-JS
Fort Monmouth, NJ 07703-5305

Director Federal Aviation Administration FAA Technical Center Atlantic City, NJ 08405

Director Walter Reed Army Institute of Research Washington, DC 20307-5100 Commander, U.S. Army Test and Evaluation Command Directorate for Test and Evaluation ATTN: AMSTE-TA-M (Human Factors Group) Aberdeen Proving Ground, MD 21005-5055

Naval Air Systems Command Technical Air Library 950D Room 278, Jefferson Plaza II Department of the Navy Washington, DC 20361

Director

U.S. Army Ballistic
Research Laboratory
ATTN: DRXBR-OD-ST Tech Reports
Aberdeen Proving Ground, MD 21005

Commander
U.S. Army Medical Research
Institute of Chemical Defense
ATTN: SGRD-UV-AO
Aberdeen Proving Ground,
MD 21010-5425

Commander
USAMRMC
ATTN: SGRD-RMS
Fort Detrick, Frederick, MD 21702-5012

HQ DA (DASG-PSP-O) 5109 Leesburg Pike Falls Church, VA 22041-3258

Harry Diamond Laboratories ATTN: Technical Information Branch 2800 Powder Mill Road Adelphi, MD 20783-1197 U.S. Army Materiel Systems
Analysis Agency
ATTN: AMXSY-PA (Reports Processing)
Aberdeen Proving Ground
MD 21005-5071

U.S. Army Ordnance Center and School LibrarySimpson Hall, Building 3071Aberdeen Proving Ground, MD 21005

U.S. Army Environmental
Hygiene Agency
ATTN: HSHB-MO-A
Aberdeen Proving Ground, MD 21010

Technical Library Chemical Research and Development Center Aberdeen Proving Ground, MD 21010-5423

Commander
U.S. Army Medical Research
Institute of Infectious Disease
ATTN: SGRD-UIZ-C
Fort Detrick, Frederick, MD 21702

Director, Biological Sciences Division Office of Naval Research 600 North Quincy Street Arlington, VA 22217

Commandant
U.S. Army Aviation
Logistics School ATTN: ATSQ-TDN
Fort Eustis, VA 23604

Headquarters (ATMD)
U.S. Army Training
and Doctrine Command
ATTN: ATBO-M
Fort Monroe, VA 23651

IAF Liaison Officer for Safety USAF Safety Agency/SEFF 9750 Avenue G, SE Kirtland Air Force Base NM 87117-5671

Naval Aerospace Medical Institute Library Building 1953, Code 03L Pensacola, FL 32508-5600

Command Surgeon
H SCENTCOM 3G)
U.S Central Comm
MacDill Air Force Base, FL 33608

Director
Directorate of Combat Developments
ATTN: ATZQ-CD
Building 515
Fort Rucker, AL 36362

U.S. Air Force Institute of Technology (AFIT/LDEE) Building 640, Area B Wright-Fatterson Air Force Base, OH 45433

Henry L. Taylor
Director, Institute of Aviation
University of Illinois-Willard Airport
Savoy, IL 61874

Chief, National Guard Bureau ATTN: NGB-ARS Arlington Hall Station 111 South George Mason Drive Arlington, VA 22204-1382

AAMRL/HEX Wright-Patterson Air Force Base, OH 45433 Commander
U.S. Army Aviation and Troop Command
ATTN: AMSAT-R-ES
4300 Goodfellow Bouvelard
St. Louis, MO 63120-1798

U.S. Army Aviation and Troop Command Library and Information Center Branch ATTN: AMSAV-DIL4300 Goodfellow BoulevardSt. Louis, MO 63120

Federal Associon Administration Civil Aeromedical Institute Library AAM-400A P.O. Box 25082 Oklahoma City, OK 73125

Commander
U.S. Army Medical Department
and School
ATTN: Library
Fort Sam Houston, TX 78234

Commander
U.S. Army Institute of Surgical Research
ATTN: SGRD-USM
Fort Sam Houston, TX 78234-6200

Air University Library (AUL/LSE)
Maxwell Air Force Base, AL 36112

Product Manager Aviation Life Support Equipment ATTN: SFAE-AV-LSE 4300 Goodfellow Boulevard St. Louis, MO 63120-1798 Commander and Director
USAE Waterways Experiment Station
ATTN: CEWES-IM-MI-R,
CD Department
3909 Halls Ferry Road
Vicksburg, MS 39180-6199

Commanding Officer Naval Biodynamics Laboratory P.O. Box 24907 New Orleans, LA 70189-0407

Assistant Commandant U.S. Army Field Artillery School ATTN: Morris Swott Technical Library Fort Sill, OK 73503-0312

Mr. Peter Seib Human Engineering Crew Station Box 266 Westland Helicopters Limited Yeovil, Somerset BA20 2YB UK

U.S. Army Dugway Proving Ground Technical Library, Building 5330 Dugway, UT 84022

U.S. Army Yuma Proving Ground Technical Library Yuma, AZ 85364

AFFTC Technical Library 6510 TW/TSTL Edwards Air Force Base, CA 93523-5000

Commander Code 3431 Naval Weapons Center China Lake, CA 93555 Aeromechanics Laboratory U.S. Army Research and Technical Labs Ames Research Center, M/S 215-1 Moffett Field, CA 94035

Sixth U.S. Army ATTN: SMA Presidio of San Francisco, CA 94129

Commander
U.S. Army Aeromedical Center
Fort Rucker, AL 36362

Strughold Aeromedical Library Document Service Section 2511 Kennedy Circle Brooks Air Force Base, TX 78235-5122

Dr. Diane Damos Department of Human Factors ISSM, USC Los Angeles, CA 90089-0021

U.S. Army White Sands
Missile Range
ATTN: STEWS-IM-ST
White Sands Missile Range, NM 88002

Director, Airworthiness Qualification Test Directorate (ATTC) ATTN: STEAT-AQ-O-TR (Tech Lib) 75 North Flightline Road Edwards Air Force Base, CA 93523-6100

Ms. Sandra G. Hart Ames Research Center MS 262-3 Moffett Field, CA 94035

Commander
USAMRMC
ATTN: SGRD-UMZ
Fort Detrick, Frederick, MD 21702-5009

Commander
U.S. Army Health Services Command
ATTN: HSOP-SO
Fort Sam Houston, TX 78234-6000

U. S. Army Research Institute Aviation R&D Activity ATTN: PERI-IR Fort Rucker, AL 36362

Commander U.S. Army Safety Center Fort Rucker, AL 36362

U.S. Army Aircraft Development Test Activity ATTN: STEBG-MP-P Cairns Army Air Field Fort Rucker, AL 36362

Commander
USAMRMC
ATTN: SGRD-PLC (COL R. Gifford)
Fort Detrick, Frederick, MD 21702

TRADOC Aviation LO Unit 21551, Box A-209-A APO AE 09777

Netherlands Army Liaison Office Building 602 Fort Rucker, AL 36362

British Army Liaison Office Building 602 Fort Rucker, AL 36362

Italian Army Liaison Office Building 602 Fort Rucker, AL 36362 Directorate of Training Development Building 502 Fort Rucker, AL 36362

Chief USAHEL/USAAVNC Field Office P. O. Box 716 Fort Rucker, AL 36362-5349

Commander, U.S. Army Aviation Center and Fort Rucker ATTN: ATZQ-CG Fort Rucker, AL 36362

Dr. Sehchang Hah
Dept. of Behavior Sciences and Leadership, Building 601, Room 281
U. S. Military Academy
West Point, NY 10996-1784

Canadian Army Liaison Office Building 602 Fort Rucker, AL 36362

German Army Liaison Office Building 602 Fort Rucker, AL 36362

French Army Liaison Office USAAVNC (Building 602) Fort Rucker, AL 36362-5021

Australian Army Liaison Office Building 602 Fort Rucker, AL 36362

Dr. Garrison Rapmund 6 Burning Tree Court Bethesda, MD 20817

Commandant, Royal Air Force Institute of Aviation Medicine Farnborough, Hampshire GU14 6SZ UK Defense Technical Information Cameron Station, Building 5 Alexandra, VA 22304-6145

Commander, U.S. Army Foreign Science and Technology Center AIFRTA (Davis) 220 7th Street, NE Charlottesville, VA 22901-5396

Commander
Applied Technology Laboratory
USARTL-ATCOM
ATTN: Library, Building 401
Fort Eustis, VA 23604

Commander, U.S. Air Force
Development Test Center
101 West D Avenue, Suite 117
Eglin Air Force Base, FL 32542-5495

Aviation Medicine Clinic TMC #22, SAAF Fort Bragg, NC 28305

Dr. H. Dix Christensen Bio-Medical Science Building, Room 753 Post Office Box 26901 Oklahoma City, OK 73190

Commander, U.S. Army Missile
Command
Redstone Scientific Information Center
ATTN: AMSMI-RD-CS-R
/ILL Documents
Redstone Arsenal, AL 35898

Aerospace Medicine Team HQ ACC/SGST3 162 Dodd Boulevard, Suite 100 Langley Air Force Base, VA 23665-1995 U.S. Army Research and Technology Laboratories (AVSCOM) Propulsion Laboratory MS 302-2 NASA Lewis Research Center Cleveland, OH 44135

Commander
USAMRMC
ATTN: SGRD-ZC (COL John F. Glenn)
Fort Detrick, Frederick, MD 21702-5012

Dr. Eugene S. Channing 166 Baughman's Lane Frederick, MD 21702-4083

U.S. Army Medical Department and School USAMRDALC Liaison ATTN: HSMC-FR Fort Sam Houston, TX 78234

NVESD AMSEL-RD-NV-ASID-PST (Attn: Trang Bui) 10221 Burbeck Road Fort Belvior, VA 22060-5806

CA Av Med HQ DAAC Middle Wallop Stockbridge, Hants S020 8DY UK

Dr. Christine Schlichting Behavioral Sciences Department Box 900, NAVUBASE NLON Groton, CT 06349-5900

Commander Aviation Applied Technology Directorate ATTN: AMSAT-R-TV Fort Eustis, VA 23604-5577 COL Yehezkel G. Caine, MD Surgeon General, Israel Air Force Aeromedical Center Library P. O. Box 02166 I.D.F. Israel

HQ ACC/DOHP 205 Dodd Boulevard, Suite 101 Langley Air Force Base, VA 23665-2789

41st Rescue Squadron 41st RQS/SG 940 Range Road Patrick Air Force Base, FL 32925-5001

48th Rescue Squadron 48th RQS/SG 801 Dezonia Road Holloman Air Force Base, NM 88330-7715

HQ, AFOMA ATTN: SGPA (Aerospace Medicine) Bolling Air Force Base, Washington, DC 20332-6128

ARNG Readiness Center ATTN: NGB-AVN-OP Arlington Hall Station 111 South George Mason Drive Arlington, VA 22204-1382

35th Fighter Wing 35th FW/SG PSC 1013 APO AE 09725-2055

66th Rescue Squadron 66th RQS/SG 4345 Tyndall Avenue Nellis Air Force Base, NV 89191-6076 71st Rescue Squadron 71st RQS/SG 1139 Redstone Road Patrick Air Force Base, FL 32925-5000

Director
Aviation Research, Development
and Engineering Center
ATTN: AMSAT-R-Z
4300 Goodfellow Boulevard
St. Louis, MO 63120-1798

Commander
USAMRMC
ATTN: SGRD-ZB (COL C. Fred Tyner)
Fort Detrick, Frederick, MD 21702-5012

Commandant
U.S. Army Command and General Staff
College
ATTN: ATZL-SWS-L
Fort Levenworth, KS 66027-6900

ARNG Readiness Center ATTN: NGB-AVN-OP Arlington Hall Station 111 South George Mason Drive Arlington, VA 22204-1382

Director Army Personnel Research Establishment Farnborough, Hants GU14 6SZ UK

Dr. A. Kornfield 895 Head Street San Francisco, CA 94132-2813

ARNG Readiness Center AATN: NGB-AVN-OP Arlington Hall Station 111 South George Mason Drive Arlington, VA 22204-1382 Mr. George T. Singley, III
Depupty Assistant Secretary of the Army
for Research and Technology
and Chief Scientist
ATTN: Room 3E374
103 Army Pentagon
Washington, DC 20310-0103

The Honorable Gilbert F. Decker Assistant Secretary of the Army for Research, Development, and Acquisition ATTN: Room 2E672 103 Army Pentagon Washington, DC 20310-0103 Dr. Craig Dorman
Office of the Deputy Director,
Defense Research and Engineering
ATTN: Room 3D129LM
103 Army Pentagon
Washington, DC 20310-0103

HQ, AFOMA ATTN; SGPA (Aerospace Medicine) Bolling Air Force Base, Washington, DC 20332-6188

Cdr, PERSCOM ATTN: TAPC-PLA 200 Stovall Street, Rm 3N25 Alexandria, VA 22332-0413